

S E R V I C E B U L L E T I N

Fuji Heavy Industries Ltd.

NO. FAS-019

DATE January 30, 1970

1. SUBJECT : Vibration reduction of instrument panel.
2. AIRCRAFT AFFECTED: FA-200 Serial No. 12 through 75 airplanes.
3. PRIORITY : Desirable.
4. REASON : In order to reduce the vibration of left side instrument panel.
5. DESCRIPTION : Replace the spacer in the shock mounts to new ones and add the cushion rubber behind the overhanged parts of instrument panel.
6. ACCOMPLISHMENT : At any time.
7. APPROVAL : Not applicable.
8. PARTS REQUIRED : The following parts will be submitted to the owners without fee.

200-324128-003	SPACER	4 ea
200-324129-001	CUSHION ASSY	1
200-324129-003	CUSHION ASSY	1
MS24693-S28	SCREW	2
MS24693-S30	SCREW	1
AN960-6	WASHER	1
AN960D6	WASHER	2
MS35338-41	LOCK WASHER	1
NAS679A06W	NUT	3
NAS43DD1-6	SPACER	2
	ADHESIVE	AS REQUIRED

9. SPECIAL TOOLS : Nothing.
10. WEIGHT AND BALANCE: No change.
11. REFERENCE : Nothing.
12. MANPOWER : 4 MH.
13. WORK PROCEDURE :

- 13-1 Remove the left hand side instrument panel in compliance with Service Manual paragraph 11-12.
- 13-2 Fix the cushion on the structure as illustrated in figures and replace the spacers to the new ones.
- 13-3 Install the instrument panel and cover in compliance with Service Manual paragraph 11-12.

