



SERVICE BULLETIN

Fuji Heavy Industries, Ltd.

NO. FAS-023A

DATE July 30, 1970

1. SUBJECT Replacement of rod interlocked brake pedals.
2. AIRCRAFT AFFECTED : FA-200 Serial Nos. 12 through 101.
3. PRIORITY : Desirable.
4. REASON :  
Worn rudder pedal hinge portion at the connection area of the rudder pedal and interlocking rod were found out.  
Replace the master cylinder connecting rod with the revised ones to prevent possible wearing.
5. DESCRIPTION : Replace the rod interlocked brake pedals with new improved parts.
6. ACCOMPLISHMENT : At first 500 hours or 1000 hours check after receiving this Service Bulletin.
7. APPROVAL : Not applicable.
8. PARTS REQUIRED : The following parts will be submitted to the owners without fee.

PARTS NUMBER	NOMENCLATURE	Q'TY
200-524074-005	ROD ASS'Y	2
200-524079-005	ROD ASS'Y	1
200-524079-006	ROD ASS'Y	1
MS24665-134	PIN-COTTER	8

FAS-023A


Page 1



9. SPECIAL TOOLS : None required.
10. WEIGHT AND BALANCE : Negligible.
11. REFERENCE : Nothing.
12. MANPOWER : 1 MH.
13. WORK PROCEDURE :
- 13-1. Remove 4 rod interlocked brake pedals from the rudder pedals and torque tube arm portion.
- 13-2. Remove 4 rudder pedals and make the smooth surface for the worn out rudder pedal edge bracket and wipe them clean cloth which contains Arozin Solution.
- 13-3. Install the rudder pedals and new improved interlocking rod. Operate the rudder and brake after installing and make sure that the rudder and brake operations will be carried out sufficiently.

(NEW) 200-524079-006

(WAS) 200-524079-004

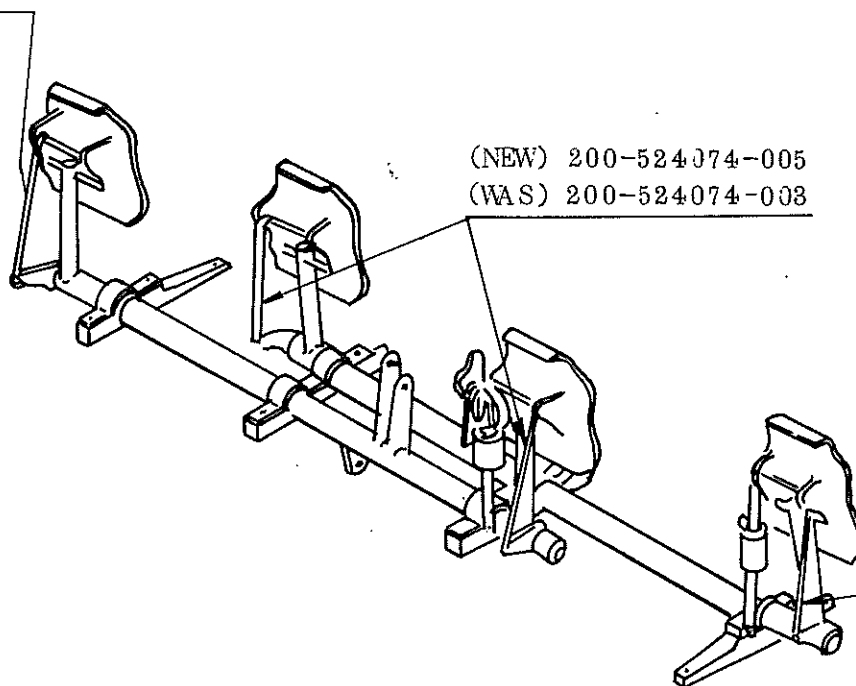

(NEW) 200-524074-005

(WAS) 200-524074-003

(NEW) 200-524079-006

(WAS) 200-524079-004