

NO. FAS-006

Fuji Heavy Industries, LTD.


DATE 17 October, 1969.

1. SUBJECT : Improvement of nose cowling bracket.
2. AIRCRAFT AFFECTED : FA-200, Serial No. 12 through 75 airplanes.
3. PRIORITY : Desirable.
4. REASON : To avoid the crack on the bracket fixing the upper and lower nose cowling.
5. DESCRIPTION : Replace the bracket to the new one.
(P/N 200-411051-009, -010)
6. ACCOMPLISHMENT : On any time.
7. APPROVAL : Not applicable.
8. PARTS REQUIRED:

200-411051-009	Plate	1 ea.
200-411051-010	Plate	1
NAS637A4	Nut Plate	2
AN525-416R8	Screw	2
AN960D416	Washer	2
9. SPECIAL TOOLS : Nothing.
10. WEIGHT AND BALANCE: No change.
11. MANPOWER : 2 MH
12. REFERENCE : Nothing.

13. WORK PROCEDURE:

- (1) Remove the upper cowling.
- (2) Replace the bracket revetted on the upper nose cowling fixing the upper and lower nose cowling, to new one. (200-411051-009, -010)
- (3) Install the upper nose cowling. On this time, make a hole $\begin{matrix} .267 \\ .525 \end{matrix}$ IN^Ø on the lower cowling on the same point of the nut plates on the bracket and fasten the screw, AN525-416R8.

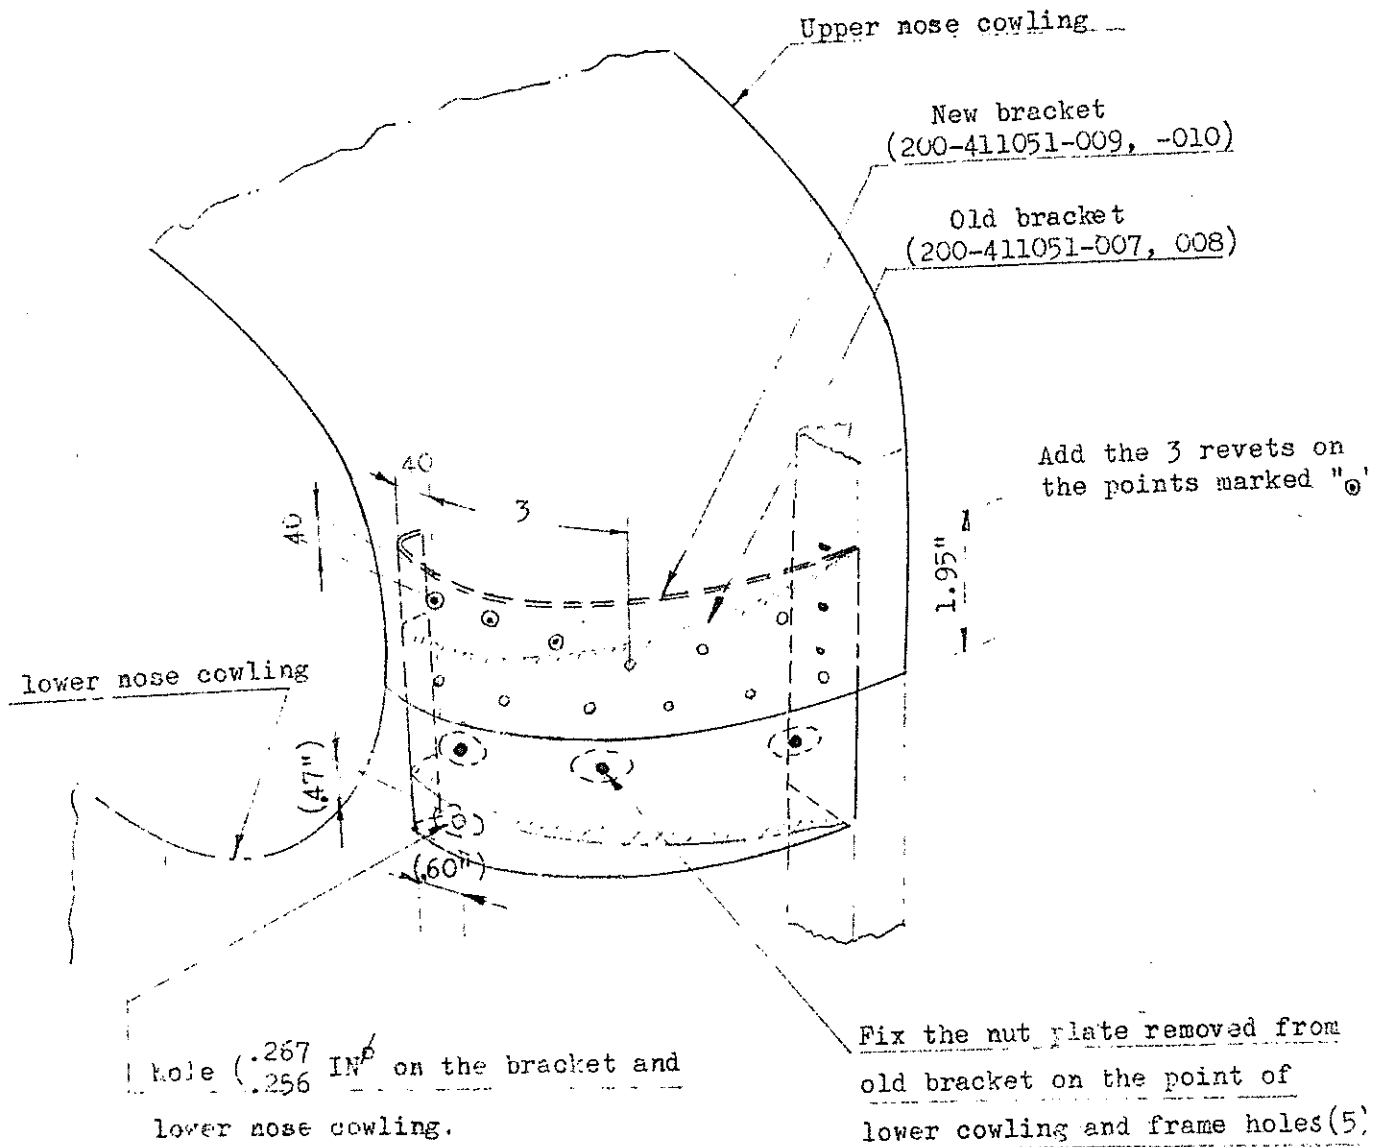

NA 607A4

AN525-416R8

AN960D416